

## CREWSAVER SERVICING AND INFORMATION BULLETIN No. 27



**Issued to :** Customers using Seacrewsader  
Lifejackets.  
Service Stations

**DATE ISSUED :** 23/06/09

**SUBJECT:** Seacrewsader Lifejackets

**ISSUED BY:-** Martin Jerrett

**EXP DATE:-** N/A

### **Seacrewsader – Precautionary Warning**


It has been identified during testing on a small number of Seacrewsader Lifejackets that manual activation is difficult due to an increase in the force required to inflate. This has now been extensively tested and we can confirm that:-

- **The twin automatic operation of both chambers is unaffected by this process and will work as the primary activation method in all cases.**
- Those lifejackets with moulded plastic pull cords are more affected as the cord stretches significantly.
- The correction can be actioned at the next service interval by replacing the moulded plastic pull cord and repacking to a new procedure.

A Service and Maintenance Bulletin No.26 is issued which details the procedure for changing the moulded pull cord and includes the repack procedure.

Page 2 of this bulletin shows the appearance of the lifejacket (check labelling as other lifejackets look very similar). The pull cord styles with their different toggle are also shown

This does not affect any other products.

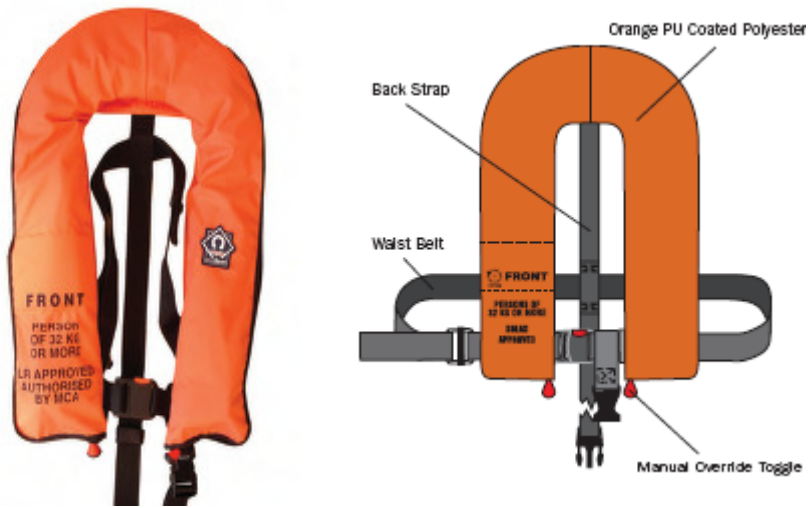

Seacrewsader Lifejacket



Woven nylon cord with toggle.



Moulded plastic cord and toggle.